









## Contents

<b>1. Introduction .....</b>	<b>6</b>
1.1. Contact Information, Support .....	6
1.2. Text Conventions.....	7
1.3. Related Documents .....	7
<b>2. Delta Software from 7.03.xx2 to 7.03.xx3 .....</b>	<b>8</b>
2.1. New Features.....	8
2.2. General Enhancements .....	8
<b>3. Document History .....</b>	<b>11</b>









Type	Description
<b>ID#5712</b>	Changed the contents of the TERMINAL PROFILE. It is aligned to table E.1 "status" column of PICS PIXIT
<b>ID#7397</b>	Improvement on handling AT#SS, AT#SL, AT#SA, to avoid wrong reports of Remote address and Local Port
<b>ID#7319</b>	Improvement on handling AT#SS and AT#SI to avoid reports negative ACK number
<b>ID#5541</b>	Improvement on #SSEND to avoid sending byte even if it reports ERROR
<b>ID#7372</b>	Handling SRING when ACK RST follows the data pkt
<b>ID#7451</b>	Handling ATA before RING on CSD data call
<b>ID#5271</b>	Changed CMUX MSC format to be aligned to ETSI specs. New format must be enabled through CMUMODE=1
<b>ID#7171</b>	Corrected handling info on System Information 2bis o 2ter to report right BaList on AT#CSURV
<b>ID#6270</b>	Improvement handling AT+CLIP with ATV0 and AT#SELINT=0/1
<b>ID#7015</b>	Handling 4.3.2.2 Authentication response by the mobile station to be compliant with 24.008
<b>ID#6903</b>	Handling Measurement Order message on R98 to PPP connection
<b>ID#6617</b>	Improvement on handling TCPATCONSER: increased buffer size for transmission, and improvement on “+++”. It doesn’t disconnect TCPATCONSER until serial buffer is empty.
<b>ID#5964</b>	Sending LOCATION STATUS to SIM STK when the operator is changed remotely with STK SMS data download
<b>ID#6263</b>	Improvement on PING answer
<b>ID#6381</b>	Improvement on handling #SI and #SRECV issue in short time after incoming SRING unsolicited
<b>ID#6135</b>	Improvement on 26Mhz Clock during power saving
<b>ID#6077</b>	Improvement on AT\$gpsp=0 and AT\$gpsp=2 to avoid at\$gpsacp returns the same string
<b>ID#6060</b>	Improvement on OTA update after FTPOPEN error
<b>ID#6002</b>	AT+CLCC? answer is not correct when MO call is remotely put in waiting
<b>ID#6073</b>	Missing NO CARRIER indication after remote hang-up
<b>ID#5960</b>	Improvement in the handling of sequence AT#SA/AT#SL/+SRING: x



Type	Description
<b>ID#5783</b>	Handling abnormal cases of socket suspension in coincidence with TCP RST received
<b>ID#5629</b>	Improvement GPRS TM A, increase performance to work with Anritzu MT8815B



